


AUSTIN ROVER

Service

BULLETIN
 Montego **TECHNICAL**

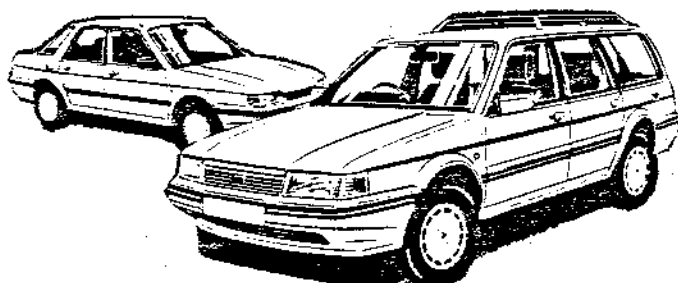

	Initials	Date
X PRINCIPAL		
X SERVICE MANAGER		
SALES MANAGER		
X PARTS MANAGER		
X WARRANTY ADMIN'R		
X SERVICE RECEPTION		
X WORKSHOP		

X indicates the persons to whom this information should be circulated

Item 1

CLUTCH CABLE PROBLEMS

DERIVATIVE: All Manual

Problem:

Premature wear of clutch centre plate.

Cause:

Clutch release cable self adjusting mechanism not operating correctly

Action:


New clutch cables have been introduced on production and are available from Unipart. They should be fitted to earlier vehicles in the event of premature clutch wear. For fitting instructions, refer to the appropriate repair manual. Part number and change point details are as follows:

Model	Old pt. no.	New pt. no.	Clear VIN
Montego 'O' rhd efi}	ADU 8851	GVC 5009	410471
Montego 'S' rhd}	ADU 8036	GVC 5015	404392
Montego 'A' rhd}	ADU 7029	GVC 5014	
Montego 'A' & 'S' lhd}	ADU 7031	GVC 5013	407617
Montego 'O' lhd efi}	ADU 9827	GVC 5012	
Montego 'O' sc rhd	ADU 7637	GVC 5007	412995
Montego 'O' Turbo rhd	ADU 9550	GVC 5008	
Montego 'O' sc lhd	ADU 7639	GVC 5010	
Montego 'O' Turbo - } Diesel lhd }	CDU 1021	GVC 5011	
Montego Diesel 'O' rhd}	ADU 9876	GVC 5016	505321

Claims:

S.R.O. 33.25.05

Complaint code: 3B0Z

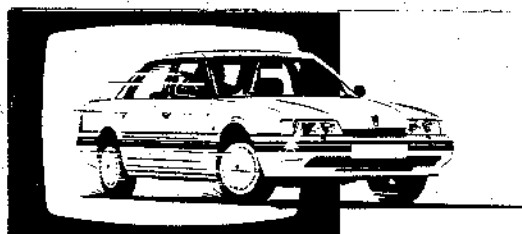

SERVICE INSIGHT



ROVER 800 SERIES

**2.7 ENGINE & ELECTRONIC
 AUTOMATIC TRANSMISSION**

VIDEO TRAINING FROM AUSTIN ROVER SERVICE