

Item 939

70. REAR BRAKE JUDDER

MAESTRO (EXCEPT VAN),  
& MONTEGO

Problem: Rear brake judder caused by drum distortion.

Action: Strengthened drums introduced at VINs:

440672 Maestro saloons  
324823 Montego saloons (except Turbo)  
327963 Turbo  
327472 Estate

The new drums may be fitted to earlier vehicles.

Part nos: NAM 7758 Maestro & Montego saloons

NAM 7766 Montego Estate

Item 940

76. FRONT DOOR FOULING  
FRONT WING

ROVER 200

Problem: Excessive flexing of rear edge of front wing  
and/or


Front edge of front door fouls wing.

Action: Check that rubber wedge, wing to 'A' post is correctly positioned. Open front door and examine gap between rear edge of front wing and 'A' post. Rubber wedge should be behind and adjacent to wing finisher strip. If it is adrift or missing, it will be necessary to remove 3 screws at rear lower edge of wheel arch liner to gain access to refit, or fit new, rubber wedge - see diagram.

Part number: DBP 6996 - Stopper, front fender

S.R.O. 76.28.00/88 (time allowance 0.20 hours)

Complaint code 9A3C

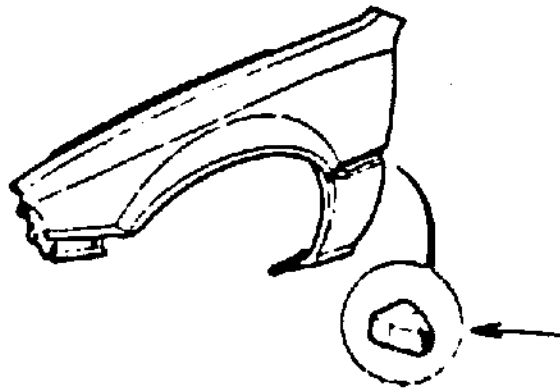

Item 941

76. WHEEL TRIMS, SECURITY OF

MONTEGO 1.6 & 2.0  
(WITH TD WHEELS)

Wheel trims which fit more securely have been introduced on production as follows:

Part no.	model	fitted from
NAM 7837ME	1.6L, 1.6HL & 2.0HL	VIN 284411
NAM 7838	1.6 & 2.0 Mayfair	VIN 292868

The new trims do not differ in appearance from the old and it is not therefore necessary to fit complete vehicle sets unless all the original ones are unsatisfactory.