

AUSTIN ROVER

Service

BULLETIN

TECHNICAL

		Initials	Date
	PRINCIPAL		
X	SERVICE MANAGER		
	SALES MANAGER		
X	PARTS MANAGER		
X	WARRANTY ADMIN'R		
X	SERVICE RECEPTION		
X	WORKSHOP		

X indicates the persons to whom this information should be circulated

Item 942

76. FRONT SEAT CUSHION COVER DAMAGED

MAESTRO VAN

Instances of the front seat cushion cover being damaged by the squab tipping mechanism have been reported.

Recurrence of this problem can be prevented by the following action:

1. Remove damaged cushion cover.
2. Fit lock-down catch spring, JPC 8890, in place of existing spring, EAM 6783, to squab pivot plates on both sides, as illustrated.
3. Remove all sharp edges and burrs from squab pivot plates.


This modification was introduced on production at VIN 4'2335.

4. Fit new cushion cover.

SERVICE NEWS

VIDEO COMMUNICATION FROM AUSTIN ROVER SERVICE

LOOK OUT
FOR TECHNICAL
FEATURES

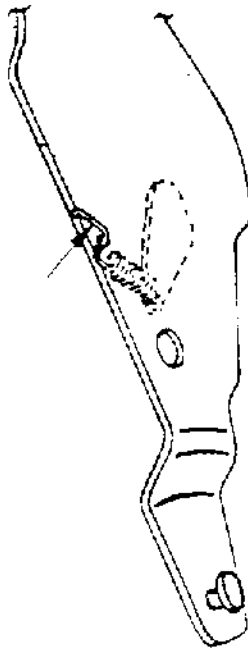

Item 943

76. HEADLINING SAGGING

MONTEGO
(WITH ROCKWELL GOLDE SUN ROOF)-

Please note that the headlining button part numbers in Item 919 should now read as follows:

JPC 4625NML becomes JPC 4625NL - beige

JPC 2625LMG becomes TJM 1094 - grey

Please amend your copies.